

# Serviceordre – Materiell

Materiellsjef F/NLF kommuniserer pålegg omkring forhold som ansees som vesentlige for å oppnå de målsettinger som er satt for materiellarbeidet via denne Service ordre. Målgruppen for Serviceordre er Materiellkontrollører, Hovedinstruktører og andre nøkkelpersoner i miljøet.

## SERVICEORDRE – 2003-04

- HENVISNING:** Sun Path Inc.'s Manufacturer Product Service Bulletin Number SP02 (Vedlagt).
- FORMÅL:** Inspeksjon av feste for justeringsspenne på justerbare seletøy fra Sun Path Inc.
- STATUS:** **Obligatorisk før neste hopp, deretter ved HK og BK.**
- IDENTIFIKASJON::** Alle Sun Path Javelin og Javelin Odyssey seletøy med justering på hovedwebbing.
- BAKGRUNN:** Ved ett tilfelle er det oppdaget at spennen for justering av seletøyets lengde har forårsaket unormalt stor slitasje på webbing. Slitasjen var så stor at webbingen nær hadde røket.
- SERVICE:** Innfesting av justeringsspenne, i krysset mellom hovedwebbing ("main lift web") og sidestrammere ("lateral side suport") på høyre og venstre side, må inspiseres før neste hopp. Ved slitasje, utover det som kan forventes ved normal bruk, skal seletøyet henvises til reparasjon. Sun Path Inc. skal kontaktes på:
- Sun Path Products, Inc.  
4439 Skydive Lane, Zephyrhills, FL 33542, USA  
tel: 00 1 813 782 9242, faks: 00 1 813 788 3057  
E-mail: info@sunpath.com
- Sun Path Inc. vil beskrive videre fremgangsmåte for korrekt reparasjon.
- UTFØRELSE:** Utføres av MK eller MR. Hovedkontrollkort merkes med **"SO03-04, dato, signatur og kontrollants NAK-nummer"**. Ved påfølgende HK og BK er merking av hovedkontrollkort ikke nødvendig.
- DISTRIBUSJON:** Klubber  
Hovedinstruktører  
Materiellkontrollører  
SU  
Sky Design  
F/NLFs Internet sider  
Hærens Jegerkommando

Stavanger, 29. juli 2003

**Rolf I. Sotberg**  
materiellsjef F/NLF

# Manufacturer Product Service Bulletin

## Number SP02

**Issue Date:** July 22, 2003

**Subject:** MANDATORY INSPECTION

**Identification:** All Adjustable Main Lift Web Harnesses on Javelin and Javelin Odyssey harness/container systems, the majority being Student Systems. The Main Lift Webs (MLW) on the left and right side are threaded through adapters mounted just above the junction of the legstrap and lateral side supports. The Adjusters are primarily used for sizing of the MLW to better fit the user during use.

**Background:** Sun Path Products, Inc. has received notification of a MLW adjuster, used on a Student Javelin harness/container system, shearing through its securing webbing. This failure may or may not have resulted in a fatality.

**Inspection Requirement:** The webbing securing the adjuster in place at the junction of the legstrap and lateral side supports is to be inspected for wear and tear. If the webbing shows signs of fraying or abrasion that is inconsistent or appears to be excessive with what would be termed “normal wear”, the harness/container system is to be grounded and Sun Path Products, Inc. is to be contacted for further action

**Qualified Inspector:** FAA Senior or Master Parachute Rigger or Foreign Equivalents.

**Compliance:** This inspection must be performed before the next jump.

**Authority:** Derek Thomas, President  
Sun Path Products, Inc.  
4439 Skydive Lane, Zephyrhills, FL 33542  
Tel: (813) 782-9242, Fax: (813) 788-3057  
E-mail: [info@sunpath.com](mailto:info@sunpath.com)

**Distribution:**

1. Sun Path Products, Inc. Website [www.sunpath.com](http://www.sunpath.com)
2. All Sun Path Products, Inc. Dealers,
3. PIA Technical and Rigging Committees
4. IPC Technical Committee
5. FAA ORL MIDO
6. FAA Engineering, Atlanta
7. All Parachuting Publications
8. National Aero Clubs, Parachuting Section
9. Military Parachute Organizations

**Note:** For purposes of updating this information, there may be a revision issued after evaluation of the subject equipment is completed.

Description of Identification (View shown is “ Wearer’s Left “)

